P19F Pressure Sensor

Features

- Constant current excitation
- Highly reliable imported pressure die
- Wide temperature range compensation
- Standard Φ19mm, customization for other diameter
- All SS316L material
- High performance, high reliability
- 18 months guarantee

Applications

- Process control systems
- Pressure calibration instruments
- Refrigeration equipment and HVAC control
- Hydraulic systems and valves
- Level measurement
- Biomedical instruments
- Ships and navigation
- Aircraft and avionics system

Notes:

1 Do not touch the diaphragm with hard objects, which may cause damage to the diaphragm.

2 Please read the Instruction Manual of the product carefully before installation and check the relevant information of the product.

3 Strictly follow the wiring method for wiring; otherwise, it may cause product damage or other potential faults.

4 Misuse of the product may cause danger or personal injury.



Product overview


The P19F pressure sensor is a core component for manufacturing pressure transmitters. As a high-performance pressure-sensitive element, it can be easily conditioned and assembled into transmitters with standard signal output.

The P19F pressure sensor encapsulates a diffused silicon pressure-sensitive die within a 316L stainless steel housing. Applied pressure is transmitted to the sensor die via the stainless steel diaphragm and internally sealed silicon oil. The sensor die does not come into direct contact with the measured medium, forming a diaphragm pressure measuring structure. Therefore, this product can be used in a wide range of applications, including harsh environments with corrosive media.

The P19F sensor adopts an O-ring for pressure sealing, facilitating easy installation.

Equivalent circuit

(1) 4 wires

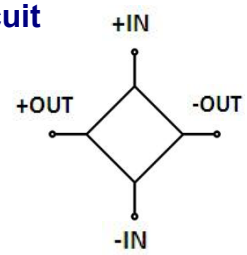

Notes:

1 Do not misuse documentation.

2 The information presented in this product sheet is for reference only. Do not use this document as a product installation guide.

3 Complete installation, operation, and maintenance information is provided in the instructions of the product.

4 Misuse of the product may cause danger or personal injury.

Electrical performance parameters	
Pressure range	0~10kPa…60MPa
Pressure reference	Gauge pressure, Absolute pressure, Sealed gauge pressure
Excitation	1.5mA recommended for constant current
Input impedance	Constant current: 2kΩ~5kΩ
Electrical connection	Gold-plated KOVAR pins or silicon wires
Compensated temp. range	0ºC ~ 60ºC (≤70kPa); -10ºC ~ 70ºC (other ranges)
Operating temp.	-40ºC ~ 120ºC
Storage temp.	-40ºC ~ 125ºC
Insulation resistance	≥200MΩ/250VDC
Response time	≤1ms (up to 90%F.S.)
Measured medium	All the liquids and gases which are compatible with SS 316L.
Mechanical vibration	20g (20~5000Hz)
Shock resistance	100g (10ms)
Service life	1×10^6 (cycles)

Structural performance parameters	
Diaphragm material	SS316L
Housing material	SS316L
Oil filling	Silicon oil
Sealing ring material	NBR or FKM

Basic parameters

Item	Condition	Min	Typical	Max	Unit	Note
Non-linearity		-0.3	±0.2	0.3	%F.S.	Notes(1)
Hysteresis		-0.05	±0.03	0.05	%F.S.	
Repeatability		-0.05	±0.03	0.05	%F.S.	
Zero output		-2	±1	2	mV	
Full scale output	1.5mA (10kPa) 1.5mA (other ranges)	30 60	90	150	mV	
Zero temp. drift	10kPa (other ranges)	-2 -1.5	±1.5 ±0.75	2 1.5	%F.S.	Note(2)
Sensitivity temp. drift		-1.5	±0.75	1.5	%F.S.	Note(2)
Thermal hysteresis		-0.075	±0.05	0.075	%F.S.	Note(3)
Long-term stability		-0.3	±0.2	0.3	%F.S./Year	



Notes: (1) Calculate according to the BFSL least square method. Negative pressure range is calculated in segments.

(2) Within the compensated temperature range 0ºC ~ 60ºC(≤70kPa) or -10ºC ~ 70ºC(other ranges), the middle point temperature is 30ºC for reference.

(3) After measuring pressure under the high and low temperatures, return to the middle point


temperature.

Structure and dimension (in mm)

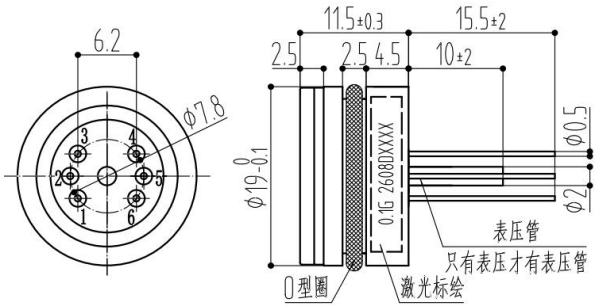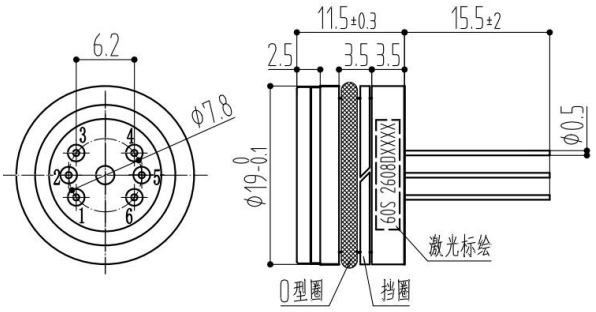Pressure range ＜16MPa	Pressure range ≥16MPa
	
Note: 表压管：Pressure gauge tube O 型圈：O-ring 激光标绘：Laser marking 只有表压才有表压管：Only gauge pressure has a gauge tube	Note: O 型圈：O-ring 挡圈：Retaining ring 激光标绘：Laser marking

Electrical connection (in mm)


1.Pin connection: 6 pins (6p) for constant current excitation

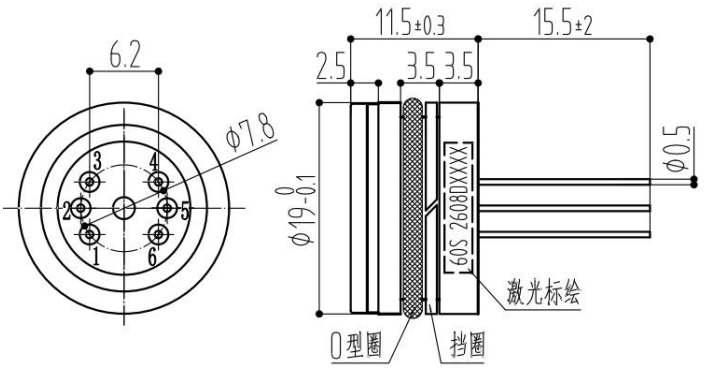

Note:
O 型圈：O-ring
挡圈：Retaining ring
激光标绘：Laser marking

Pin	Definition
3	Excitation+(IN+)
5	Excitation-(IN-)
2	Output+(OUT+)
4	Output-(OUT-)
1	Die-
6	Die-

2. Wire connection: 4 wires (4w)

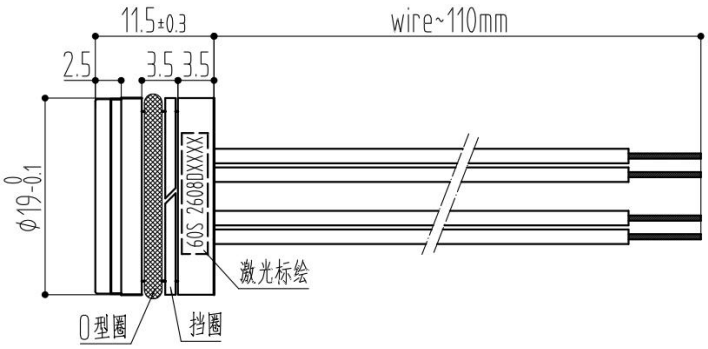

Wire color	Definition
Red	Excitation+(IN+)
Blue	Excitation-(IN-)
Yellow	Output+(OUT+)
White	Output-(OUT-)

Note:

O 型圈：O-ring

挡圈：Retaining ring

激光标绘：Laser marking


Pressure range selection

Code	Pressure reference	Pressure range	Overload pressure	Burst pressure	O-ring
10k	G	0～10kPa	300%FS	600%FS	NBR
20k	G	0～20kPa	300%FS	600%FS	NBR
35k	G、A	0～35kPa	300%FS	600%FS	NBR
70k	G	0～70kPa	300%FS	600%FS	NBR
100k	G、A	0～100kPa	200%FS	500%FS	NBR
160k	G、A	0～160kPa	200%FS	500%FS	NBR
250k	G、A	0～250kPa	200%FS	500%FS	NBR
400k	G、A	0～400kPa	200%FS	500%FS	NBR
600k	G、A	0～600kPa	200%FS	500%FS	NBR
1M	G、A	0～1MPa	200%FS	500%FS	NBR
1.6M	G、A、S	0～1.6MPa	200%FS	500%FS	NBR
2.5M	G、A、S	0～2.5MPa	200%FS	500%FS	NBR
4M	S	0～4MPa	200%FS	400%FS	NBR
6M	S	0～6MPa	200%FS	400%FS	FKM
10M	S	0～10MPa	200%FS	400%FS	FKM
16M	S	0～16MPa	200%FS	400%FS	FKM
25M	S	0～25MPa	150%FS	400%FS	FKM
40M	S	0～40MPa	150%FS	300%FS	FKM
60M	S	0～60MPa	150%FS	300%FS	FKM
100M	S	0～100MPa	150%FS	300%FS	FKM
N1K	Omitted	-100～0kPa	300kPa	600kPa	NBR
N2K	Omitted	0～-100kPa	300kPa	600kPa	NBR
N3K	Omitted	±100kPa	300kPa	600kPa	NBR
N4K	Omitted	-100～160kPa	480kPa	900kPa	NBR
N5K	Omitted	-100～250kPa	750kPa	1.25MPa	NBR
N6K	Omitted	-100～400kPa	800kPa	2MPa	NBR

N7K	Omitted	-100～600kPa	1.2MPa	3MPa	NBR
N8M	Omitted	-0.1～1MPa	2MPa	5MPa	NBR

Note: G: Gauge pressure, A: Absolute pressure, S: Sealed gauge pressure

Ordering information

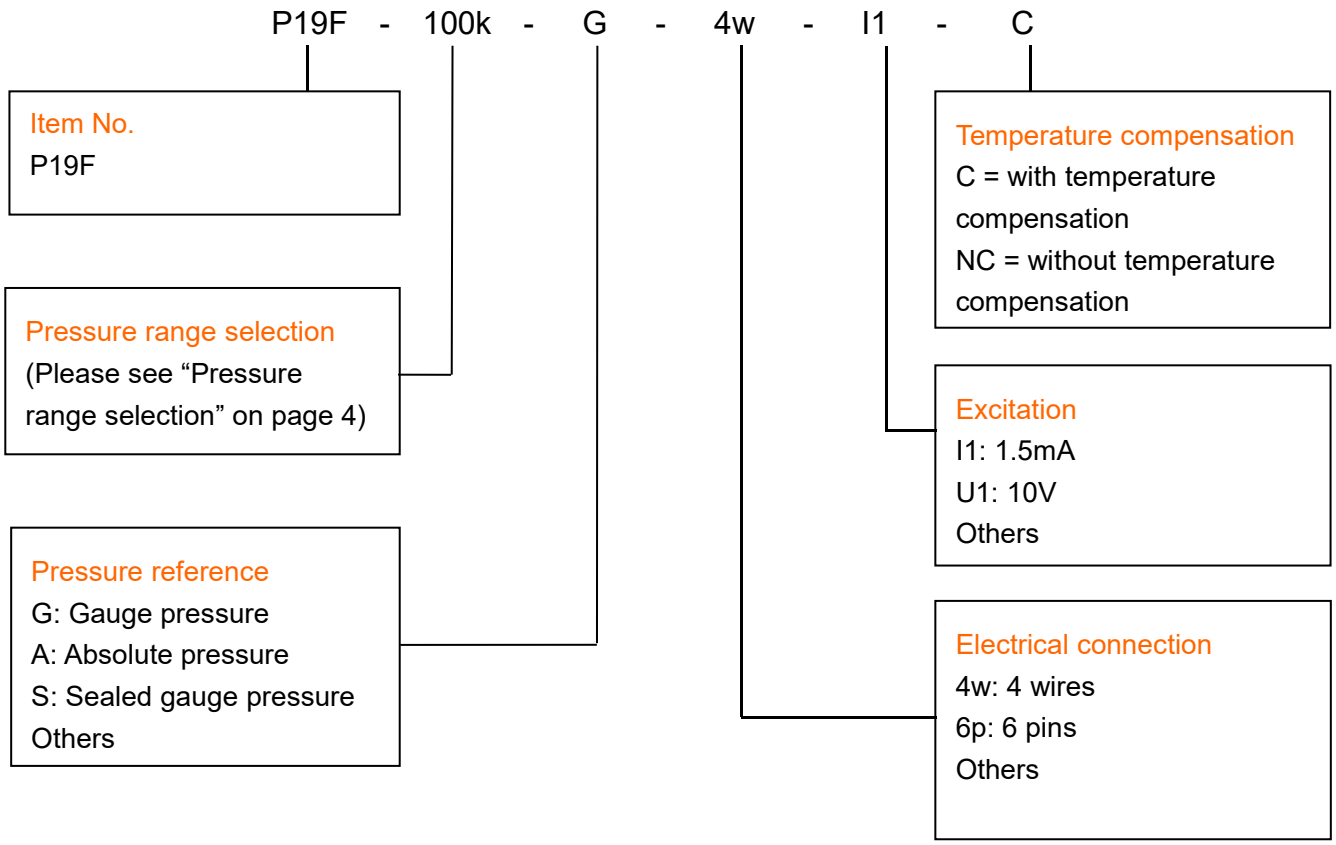

Example of ordering information: P19F- 100k - G - 4w - I1 - C

Product model: P19F, 100k: pressure range 100kPa, G: gauge pressure, 4w: 4 wires, I1: 1.5mA, C: with temperature compensation.

Ordering tips:

1 Over-range or under-range use is allowed, recommended within ±30% F.S..

2 Pressure reference: gauge pressure, absolute pressure, and sealed gauge pressure.

(1) Gauge pressure is based on the current atmospheric pressure. Generally, it refers to the measurement of pressure that is greater than the current atmospheric pressure.

(2) Absolute pressure is based on a vacuum.

(3) For sealed gauge pressure, absolute pressure is adopted as gauge pressure with reference to on-site atmospheric pressure during production. For pressure ranges above 4MPa, gauge pressure cannot be selected, but only sealed gauge pressure.

3 Confirm the maximum overload of the applied system, which should be less than the overload protection limit of the sensor; otherwise, it will affect the product’s service life or even damage the product.

4 1.5mA constant current compensation is standard. Suggest selecting this option with priority.
5 Negative pressure sensors differ completely in materials and processes from positive pressure sensors, so it cannot be replaced by standard gauge pressure sensors.
6 For special requirements on performance parameters and functions of the product, please contact us.

Wotian reserves the right to make any change in this publication without notice. The information provided is believed to be accurate and reliable as of this product sheet.

Contact us

Nanjing Wotian Technology Co.,Ltd.

Website: www.wtsensor.com

Add: 5 Wenying Road, Binjiang Development Zone, Nanjing, 211161, China

E-mail：dr@wtsensor.com