

PC91B Monocrystalline silicon pressure sensor

Features

- Adopt imported MEMS monocrystalline silicon pressure dies
- With overpressure protection
- ■316L stainless steel fully welded integral structure
- Gauge pressure type can be used for negative pressure measurement
- Suitable for various threaded housings

Applications

Provide OEM parts for industrial transmitter manufacturers.

Notes:

- Do not touch the diaphragm with hard objects, as it may cause damage to the isolation diaphragm.
- 2. Please read the product manual carefully before installation and check the relevant information of the product.
- Connect the wires strictly in accordance with the wiring method; otherwise, it may cause damage to the product and other potential faults.
- Incorrect use may lead to danger and personal injury.



Product overview

The PC91B monocrystalline silicon pressure sensor adopts imported MEMS monocrystalline silicon pressure dies, achieving internationally leading overpressure performance and ensuring excellent signal stability. It is assembled with a fully welded sealed structure and filled with silicone oil under high vacuum. Different materials of measurement diaphragms not only isolate the measured medium from the pressure die but also enable the sensor to reliably measure the pressure difference signals of various strongly corrosive media over the long term.

In the PC91B monocrystalline silicon pressure sensor, the measured pressure directly acts on the sensor's diaphragm, causing a micro-displacement proportional to the pressure. Integrated electronic circuits detect this change and convert it into a corresponding standard measurement signal for pressure.

Notes:

- 1. Do not touch the diaphragm with hard objects, as it may cause damage to the isolation diaphragm.
- 2. Please read the product manual carefully before installation and check the relevant information of the product.
- 3. Connect the wires strictly in accordance with the wiring method; otherwise, it may cause damage to the product and other potential faults.
- 4. Incorrect use may lead to danger and personal injury.



Performance parameters		
Power supply	5V DC	
Operating temp.	-40℃~85℃	
Storage temp.	-50℃~125℃	
Output	60∼140mV	
Zero-point	±0.1%FS/℃(Range≥10kPa)	
temperature drift	±0.5%FS/℃(Range<10kPa)	
Thermal	±0.1%FS (Range<10kPa)	
hysteresis	±0.05%FS (Range≥10kPa)	
Pressure	±0.05%FS	
hysteresis	10.03765	
Long-term drift	±0.05%FS /Year	
Non-linearity	±0.5%FS (Range≥10kPa),±1.5%FS (Range<10kPa)	
Max overpressure	See range selection	
Diaphragm	316L, Hastelloy C	
material	310L, Hastelloy C	
Thread connection	n	
Thread code	C1: M20×1.5-6g	C7F: NPT1/2 (F)
Dimension Unit: mm	Ø39 Ø35 HEX36	φ ₃₉ φ ₃₅ <u>NPT1/2(F)</u>
Suggested torque	15∼25Nm	15∼25Nm



10MA


Electrical connection Electrical schematic diagram Wire color Wiring method V+ Red o V+ Red Blue V-Yellow o OUT+ Yellow OUT+ Blue o y-White OUT-White o OUT-Green O Diode+ Green Diode+ Black o Diode-Black Diode-

Range selection Range code Pressure type Pressure range Overpressure 6kG $0{\sim}6$ kPa 30kPa Gauge pressure 40kG 200kPa $0\sim$ 40kPa Gauge pressure 100kG Gauge pressure $0\sim$ 100kPa 300kPa 250kG 750kPa Gauge pressure $0\sim$ 250kPa 1MG $0{\sim}1MPa$ 2MPa Gauge pressure 3MG Gauge pressure $0{\sim}3MPa$ 6MPa 100kA Absolute pressure $0\sim$ 100kPa 300kPa 250kA Absolute pressure $0\sim$ 250kPa 750kPa

 $0\sim 10 MPa$

20MPa

Absolute pressure

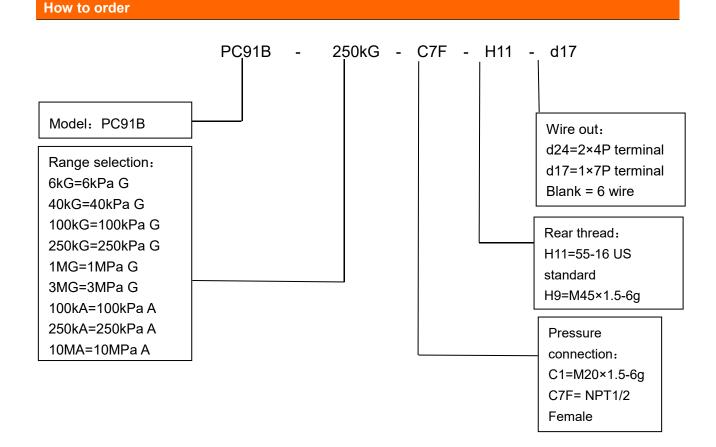



Example: PC91B-250kGC7FH11d24

It means PC91B, range: 250kPa, pressure type: gauge pressure, interface thread: NPT1/2 female, rear thread: 55-16 US standard thread, diaphragm material: 316L stainless steel, 2×4P terminal lead-out.

Contact us

Nanjing Wotian Technology Co.,Ltd.

Website: www.wtsensor.com

Add: 5 Wenying Road, Binjiang Development Zone, Nanjing, 211161, China

Email:dr@wtsensor.com